


# Inductive proximity sensors


XS range, general purpose

Cylindrical, metal, increased range, flush mountable


Four-wire DC, solid-state NO + NC output

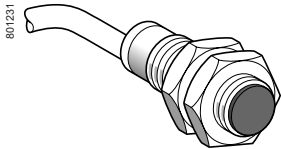

XS1●●B3PCL2

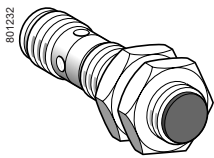

XS112B3PCM12



XSZB●●●

## Sensors, 4-wire

Sensing distance (Sn) mm	Function	Output	Connection	Reference	Weight kg
<b>Ø 8, threaded M8 x 1</b>					
2.5	NO + NC	PNP	Pre-cabled (L = 2 m)	<b>XS608B1PCL2</b>	0.035
			M12 connector	<b>XS608B1PCM12</b>	0.025

<b>Ø 12, threaded M12 x 1</b>					
4	NO + NC	PNP	Pre-cabled (L = 2 m)	<b>XS112B3PCL2</b>	0.070
			M12 connector	<b>XS112B3PCM12</b>	0.020

<b>Ø 18, threaded M18 x 1</b>					
8	NO + NC	PNP	Pre-cabled (L = 2 m)	<b>XS118B3PCL2</b>	0.100
			M12 connector	<b>XS118B3PCM12</b>	0.040

<b>Ø 30, threaded M30 x 1.5</b>					
15	NO + NC	PNP	Pre-cabled (L = 2 m)	<b>XS130B3PCL2</b>	0.160
			M12 connector	<b>XS130B3PCM12</b>	0.100

## Accessories (1)

Description	For use with sensors	Reference	Weight kg
Fixing clamps	Ø 8	<b>XSZB108</b>	0.006
	Ø 12	<b>XSZB112</b>	0.006
	Ø 18	<b>XSZB118</b>	0.010
	Ø 30	<b>XSZB130</b>	0.020

(1) For further information, see page 118.