


Inductive proximity sensors


XS range, general purpose

Cylindrical, metal and plastic, flush mountable and non flush mountable


Four-wire DC, solid-state NO + NC output

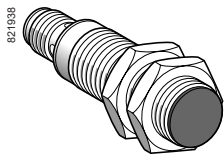


XS●●18●C410

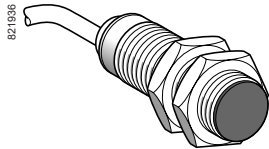

XS●●18●C410D

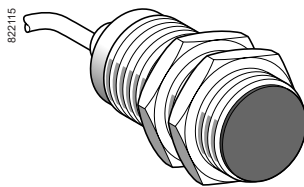

XS●●30●C410



XSZB1●●

Sensing distance (Sn) mm	Function	Output	Connection	Reference	Weight kg
Ø 18, threaded M18 x 1					
Brass case, flush mountable					
5	NO + NC	PNP	Pre-cabled (L = 2 m) (1) (2)	XS1N18PC410	0.100
			M12 connector	XS1N18PC410D	0.040
		NPN	Pre-cabled (L = 2 m)	XS1N18NC410	0.100
			M12 connector	XS1N18NC410D	0.040
Plastic case, non flush mountable					
8	NO + NC	PNP (3)	Pre-cabled (L = 2 m)	XS4P18PC410	0.100
			M12 connector	XS4P18PC410D	0.040
Ø 30, threaded M30 x 1.5					
Brass case, flush mountable					
10	NO + NC	PNP	Pre-cabled (L = 2 m) (1) (2)	XS1N30PC410	0.160
			M12 connector	XS1N30PC410D	0.100
		NPN	Pre-cabled (L = 2 m)	XS1N30NC410	0.160
			M12 connector	XS1N30NC410D	0.100
Plastic case, non flush mountable					
15	NO + NC	PNP (3)	Pre-cabled (L = 2 m)	XS4P30PC410	0.160
			M12 connector	XS4P30PC410D	0.100
Accessories (4)					
Description				Reference	Weight kg
Fixing clamps		Ø 8		XSZB108	0.006
		Ø 12		XSZB112	0.006
		Ø 18		XSZB118	0.010
		Ø 30		XSZB130	0.020

(1) For a 5 m long cable add **L1** to the reference. Example: **XS1N18PC410** becomes **XS1N18PC410L1** with a 5 m long cable.

(2) For a 10 m long cable add **L2** to the reference. Example: **XS1N18PC410** becomes **XS1N18PC410L2** with a 10 m long cable.

(3) These sensors can be supplied in NPN versions. Please contact our Customer Care Centre.

(4) For further information, see page 118.