


Inductive proximity sensors


XS range, general purpose

Cylindrical, increased range, flush mountable


Three-wire DC, solid-state output

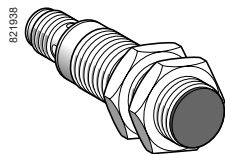


XS118B3●●M12

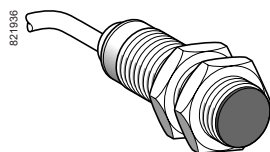

XS118B3●●L2

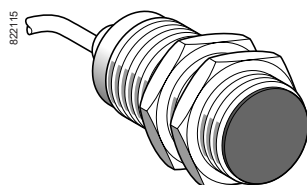

XS130B3●●L2



XSZB1●●

Sensors, 3-wire 12-24 V, short case model (continued)

Sensing distance (Sn) mm	Function	Output	Connection	Sold in lots of	Unit reference	Weight kg
Ø 18, threaded M18 x 1						
8	NO	PNP	Pre-cabled (L = 2 m) (1)	1	XS118B3PAL2	0.110
			M12 connector	1	XS118B3PAM12	0.060
	NPN	Pre-cabled (L = 2 m)	20	XS118B3PAL2TQ	2.000	
			M12 connector	20	XS118B3PAM12TQ	1.140
		Pre-cabled (L = 2 m) (1)	1	XS118B3NAL2	0.110	
			M12 connector	1	XS118B3NAM12	0.060
NC	PNP	Pre-cabled (L = 2 m)	20	XS118B3NAL2TQ	2.000	
			M12 connector	20	XS118B3NAM12TQ	1.140
	NPN	Pre-cabled (L = 2 m) (1)	1	XS118B3PBL2	0.110	
			M12 connector	1	XS118B3PBM12	0.060
		Pre-cabled (L = 2 m) (1)	1	XS118B3NBL2	0.110	
			M12 connector	1	XS118B3NBM12	0.060
Ø 30, threaded M30 x 1.5						
15	NO	PNP	Pre-cabled (L = 2 m) (1)	1	XS130B3PAL2	0.180
			M12 connector	1	XS130B3PAM12	0.130
	NPN	Pre-cabled (L = 2 m)	20	XS130B3PAL2TQ	3.360	
			M12 connector	20	XS130B3PAM12TQ	2.000
		Pre-cabled (L = 2 m) (1)	1	XS130B3NAL2	0.180	
			M12 connector	1	XS130B3NAM12	0.130
NC	PNP	Pre-cabled (L = 2 m)	20	XS130B3NAM12TQ	2.000	
			M12 connector	1	XS130B3PBL2	0.180
	NPN	Pre-cabled (L = 2 m) (1)	1	XS130B3PBM12	0.130	
			M12 connector	1	XS130B3PBM12	0.130
		Pre-cabled (L = 2 m) (1)	1	XS130B3NBL2	0.180	
			M12 connector	1	XS130B3NBM12	0.130

Accessories (2)

Description	For use with sensors	Reference	Weight kg
Fixing clamps	Ø 6.5 (plain)	XSZB165	0.005
	Ø 8 (M8 x1)	XSZB108	0.006
	Ø 12 (M12 x1)	XSZB112	0.006
	Ø 18 (M18 x1)	XSZB118	0.010
	Ø 30 (M30 x 1.5)	XSZB130	0.020

(1) For a 5 m cable, replace L2 by L5. Please consult our Customer Care Centre for availability.
Example: XS118B3PAL2 becomes XS118B3PAL5 with a 5 m cable.

(2) For more information, see page 118.